



23. Install new PCV hose to the engine. Plug the small vacuum lines into the lower intake manifold nipples as described.


NEW PCV HOSE

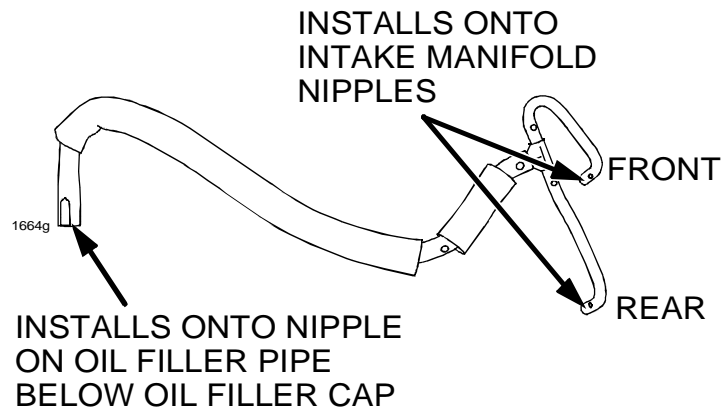


24. Route new PCV hose and through new clip at break in hose insulation.

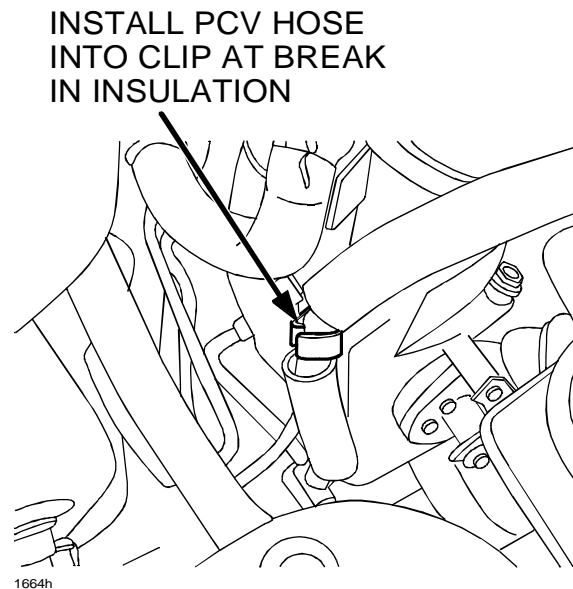


25. Route new PCV hose across engine and install into new oil filler pipe nipple with White line pointing upward.

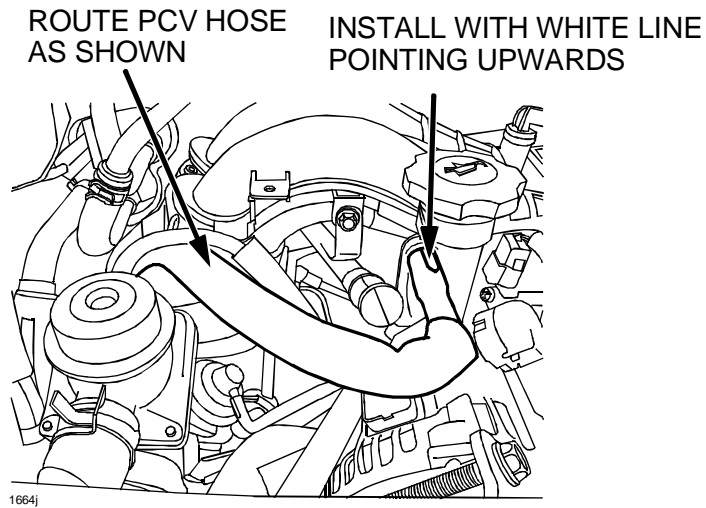


26. From the kit, install nipple into the White mark end of the elbow hose.

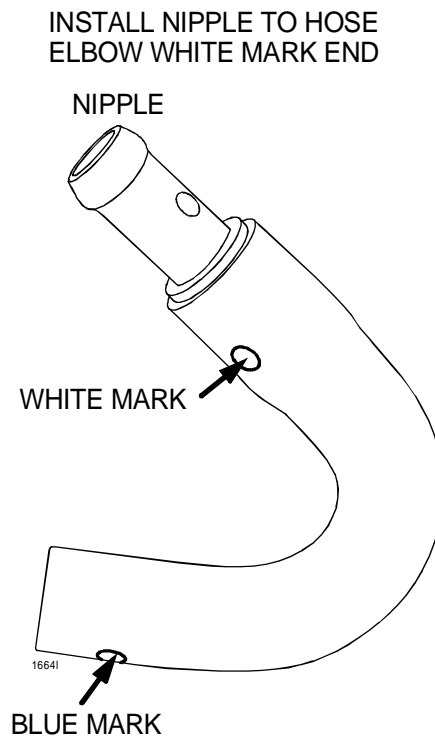

27. Route new PCV hose as shown.

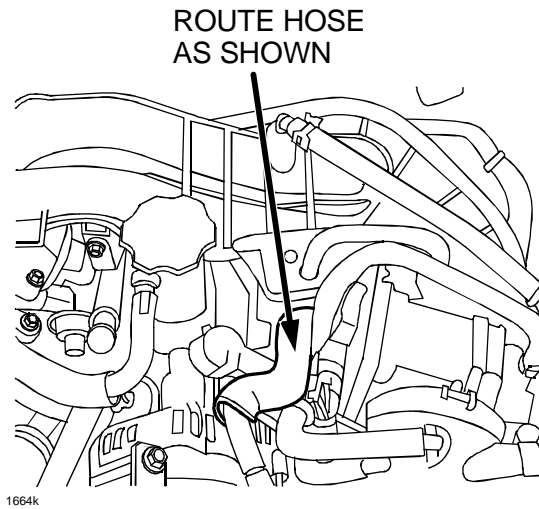

28. Connect new elbow hose to intake air hose nipple and insert nipple of new hose into new PCV hose as shown. Ensure marks are aligned properly.

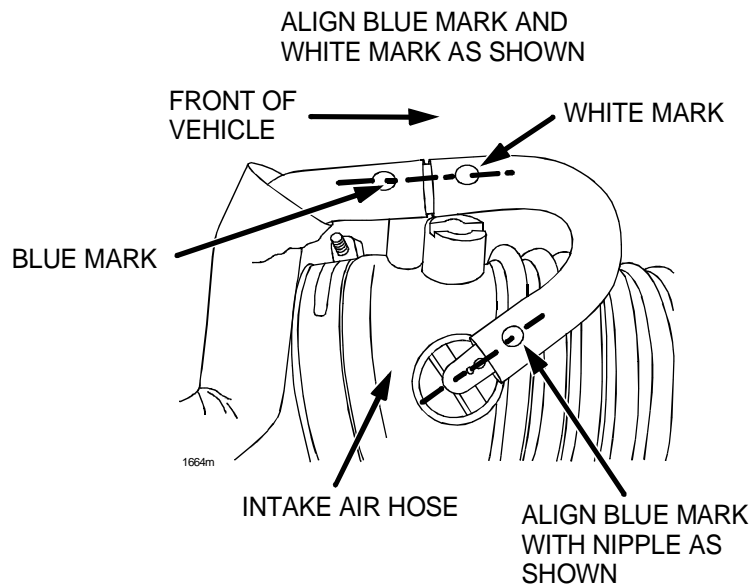


29. Connect negative battery cable and install battery end engine cover.

- If vehicle is equipped with DSC, perform the steering angle sensor adjustment. See appropriate Workshop Manual section 04-15 STEERING ANGLE SENSOR INITIALIZATION PROCEDURE.
- Initialize power windows if necessary.
- Enter customers radio station presets.

30. Clean existing under hood label and place new vacuum hose routing label over existing vacuum hose routing portion of label.

**INSTALL NEW VACUUM HOSE ROUTING
 DIAGRAM OVER EXISTING ROUTING
 DIAGRAM ON UNDER HOOD LABEL**

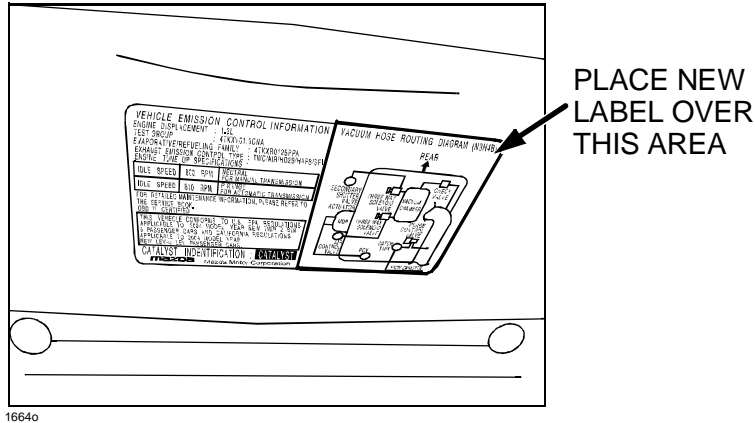

1664c

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
N3Y1-13-S80A	Ventilation Kit	1	Kit Includes: - Hose clip (1 pc) attaches to extension manifold (lower) - PCV hose ass'y (1 pc) includes "T", vacuum lines and PCV hose - Vacuum tube (1 pc) attached to oil filler pipe - PCV hose (1 pc) attached to oil filler pipe - Oil filler pipe ass'y (1 pc) includes solenoid valves and vacuum hoses - Intake manifold gasket (6 pcs) - Throttle body gasket (1 pc) - Ground bolt (1 pc) attaches hose clip to extension manifold (lower) - Oil Filler Pipe-to-Extension Manifold (upper) Bolt (2 pcs)
N3Y1-69-036	Emission Label	1	---

Bulletin No: 01-050/06 © 2006 Mazda Motor of America, Inc.	Last Issued: 11/21/2006
--	--------------------------------

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	77
Damage Code	93
Part Number Main Cause	N3Y1-13-S80A
Quantity	1
Operation Number / Labor Hours:	XXB250RX / 1.2 Hrs